

Note that the VAC and mA AC functions are available only with the True RMS AC option. If this option is absent, pressing the VAC and mA AC function buttons causes the 8842A to briefly display an error message (ERROR 30).

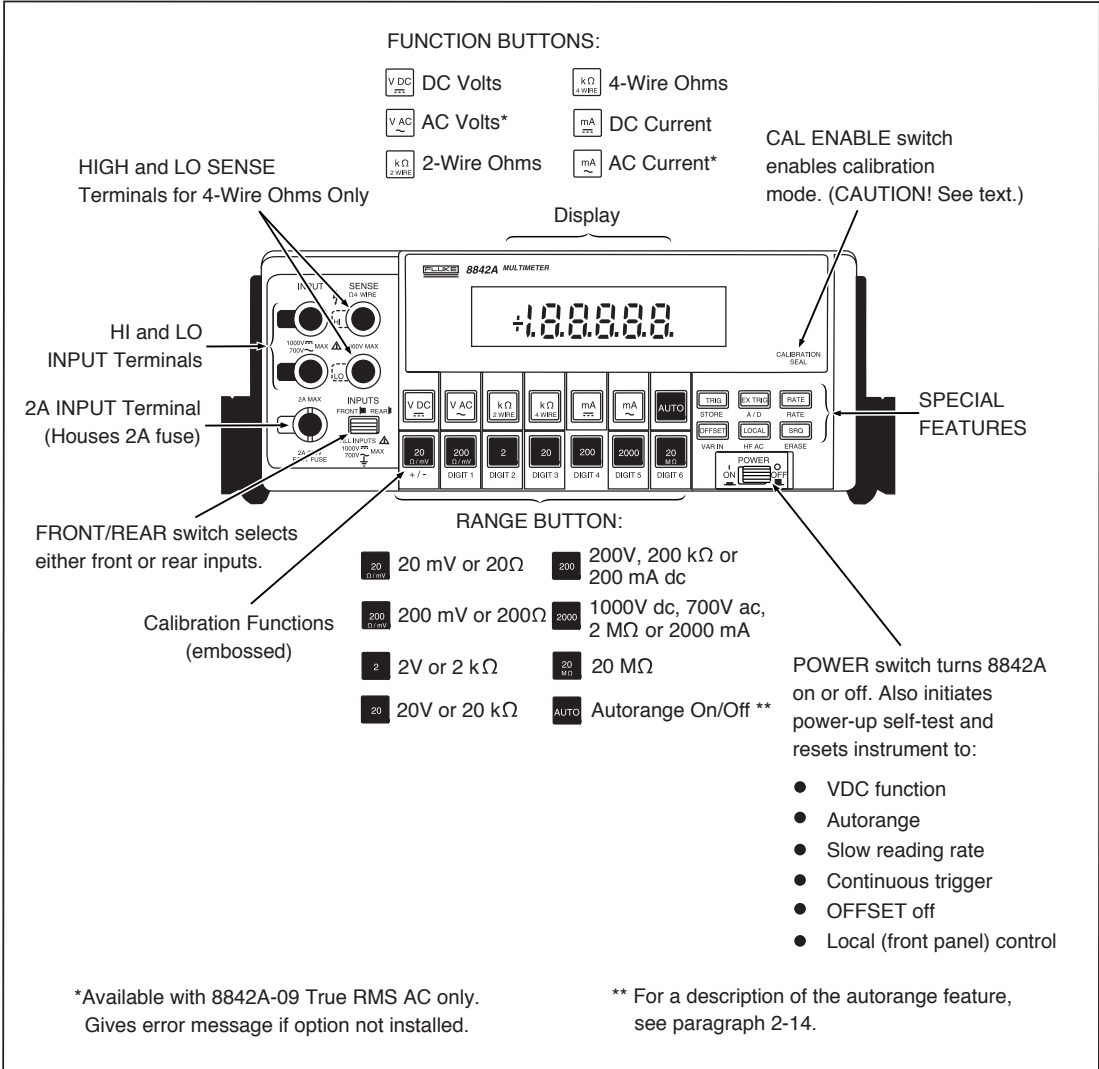


Figure 2-5. Front Panel Features

f2-05_1.wmf

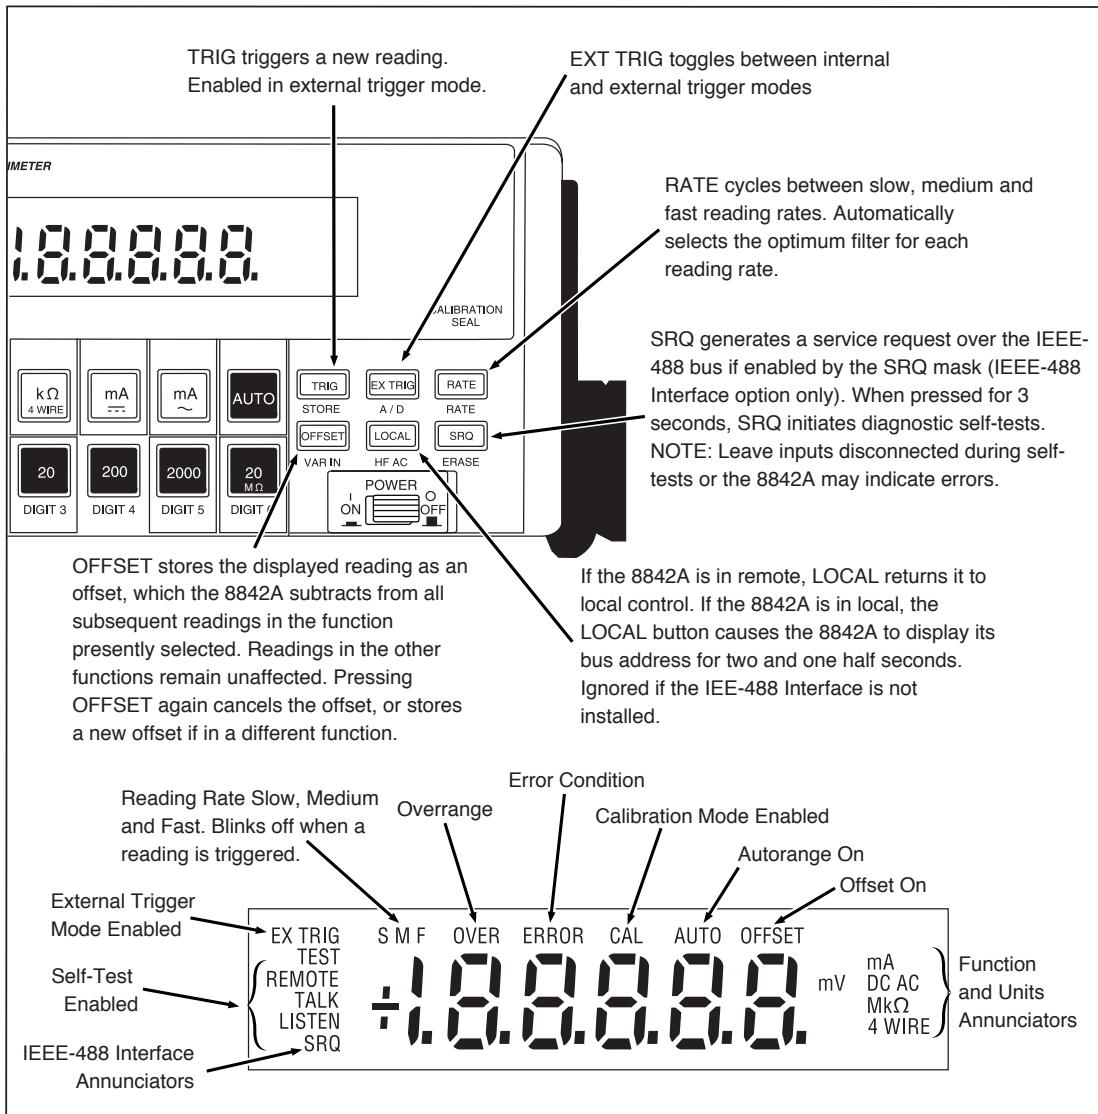


Figure 2-5. Front Panel Features (cont)

f2-05_2.wmf